

April 20, 2017

Courtney Wilton Portland Public Schools 501 North Dixon Portland, Oregon 97227

Via email: cwilton@pps.net

Regarding: Lead Paint Condition Assessment Edwards Elementary School 1715 SE 32nd Place Portland, Oregon 97214 PBS Project: 6500.721 Phase 0087

Dear Mr. Wilton:

On April 18, 2017, PBS Engineering and Environmental Inc. (PBS) conducted a visual inspection and assessment of painted and varnished surfaces on the interior and exterior of Edwards Elementary School located at 1715 SE 32nd Place in Portland, Oregon.

PBS assessed painted and varnished interior and exterior hard surfaces as well as concrete, asphalt, soil, garden spaces, compost piles, playground equipment, and windowsills adjacent or in close proximity to deteriorated painted or varnished surfaces.

Paint and varnish conditions were assessed using US Department of Housing and Urban Development (HUD) guidelines for the Evaluation and Control of Lead Based Paint Hazards in Housing (2012 Addition) Chapter 5: Risk Assessment and Reevaluation.

It is assumed that all paint and varnish at the school contain some concentration of lead. The purpose of this investigation is to identify those finishes in deteriorated condition.

FINDINGS

Overall, the building's painted and varnished surfaces were found to be in intact condition with areas of fair and deteriorated conditions. A table listing the locations and quantity of surfaces in deteriorated condition is attached to this report.

The school's metal-sliding windows displayed nothing of concern, and no paint chips were observed in the garden or compost pile; however, paint chips were observed on concrete at the east exterior of the media center.

Painted playground and parking lot striping and curbing often contain lead and are generally in deteriorated condition due to weatherization and traffic. PBS did not assess this paint, but recommends restriping, as needed, to maintain in intact condition.

Courtney Wilton, Portland Public Schools Lead Paint Condition Assessment, Edwards Elementary School April 20, 2017 Page 2 of 2

RECOMMENDATIONS

PBS recommends that all painted or varnished surfaces in deteriorated condition noted on the attached table be stabilized. All paint chips noted in this report should be removed.

Please feel free to contact me at 503.417.7691 or clark@pbsenv.com with any questions or comments.

Sincerely,

In

Clark Nelson, CIH Senior Project Manager

Attachments: Condition Assessment of Deteriorated Paint/Varnish Table Field Drawing of Deteriorated Paint and Varnish Locations Lead-based Paint Risk Assessor Certification (Clark Nelson) Lead-based Paint Activities Firm Certification (PBS Engineering and Environmental)


CN:DM:bmp

Edwards Elementary School Assessment of Paint/Varnish in Deteriorated Condition

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
А	Interior	Library	Door	Above and below	No	Wood	45
В	Interior	Room 6E	Door	Above and below	No	Wood	45
С	Interior	Room 6A	Built-ins	Below	No	Wood	30
D	Interior	Room 6A	Door	Above and below	No	Wood	45
E	Interior	Room 6	Door	Above and below	Yes	Wood	45
F	Interior	Room 7	Built-ins	Below	Yes	Wood	30
G	Interior	Room 7	Door	Above and below	Yes	Wood	45
Η	Interior	Room 8	Built-ins	Below	Yes	Wood	30
I	Interior	Room 8	Door	Above and below	Yes	Wood	45
J	Interior	Room 5	Built-ins	Below	Yes	Wood	30
K	Interior	Room 5	Door	Above and below	Yes	Wood	45
L	Interior	Room 9	Built-ins	Below	Yes	Wood	30
М	Interior	Room 9	Door	Above and below	Yes	Wood	45
Ν	Interior	Room 4	Door and closet door	Above and below	Yes	Wood	90
0	Interior	Room 10	Built-ins	Below	Yes	Wood	30
Ρ	Interior	Room 10	Door	Above and below	Yes	Wood	45
Q	Interior	Room 3	Door	Above and below	Yes	Wood	45
R	Interior	Room 3	Built-ins	Below	Yes	Wood	30
S	Interior	Room 13 custodian	Door	Above and below	No	Wood	45
Т	Interior	Room 14 supplies	Door	Above and below	No	Wood	45
U	Interior	Room 18 gym/café	Doors x2	Above and below	No	Wood	90
V	Interior	Room 18 gym/café	West wall	Below	No	Concrete	80

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
W	Interior	Kitchen	Built-ins	Below	No	Wood	50
Х	Interior	Storage door	Door	Above and below	No	Wood	45
Y	Interior	Boiler Room 16	Exterior doors	Above and below	No	Metal	90
Ζ	Interior	Boiler Room 16	Door frame	Above and below	No	Metal	15
AA	Interior	Faculty Room 20	Built-ins	Below	No	Wood	30
AB	Exterior	Main entrance	Wall	Below	No	Wood	20
AC	Exterior	Main entrance	Handrails	Below	No	Metal	60
AD	Exterior	Main entrance	Trim along roof overhang	Above	No	Wood	80
AE	Exterior	Northwest corner of building	Drain pipe	Above and below	No	Metal	10
AF	Exterior	West building entrance	Handrails	Below	No	Metal	40
AG	Exterior	East exterior of media center	Paint chips	Below	No	Concrete	20
AH	Interior	Room 16E	Built-ins	Above	No	Wood	80
AI	Interior	Room 16E	Door	Above and below	No	Metal	45
AJ	Interior	Room 16C grounds storage	Door	Above and below	No	Metal	45
AK	Exterior	South exterior of playroom and boiler room	Trim along roof overhang	Above	No	Wood	80
AL	Exterior	Southeast corner of building	Handrails	Below	No	Metal	60
AM	Interior	Room 2	Built-ins	Below	No	Wood	30
AN	Interior	Room 2	Door	Above and below	No	Wood	45
AO	Interior	Work 1B	Door	Above and below	No	Wood	45

SE MARKET ST.

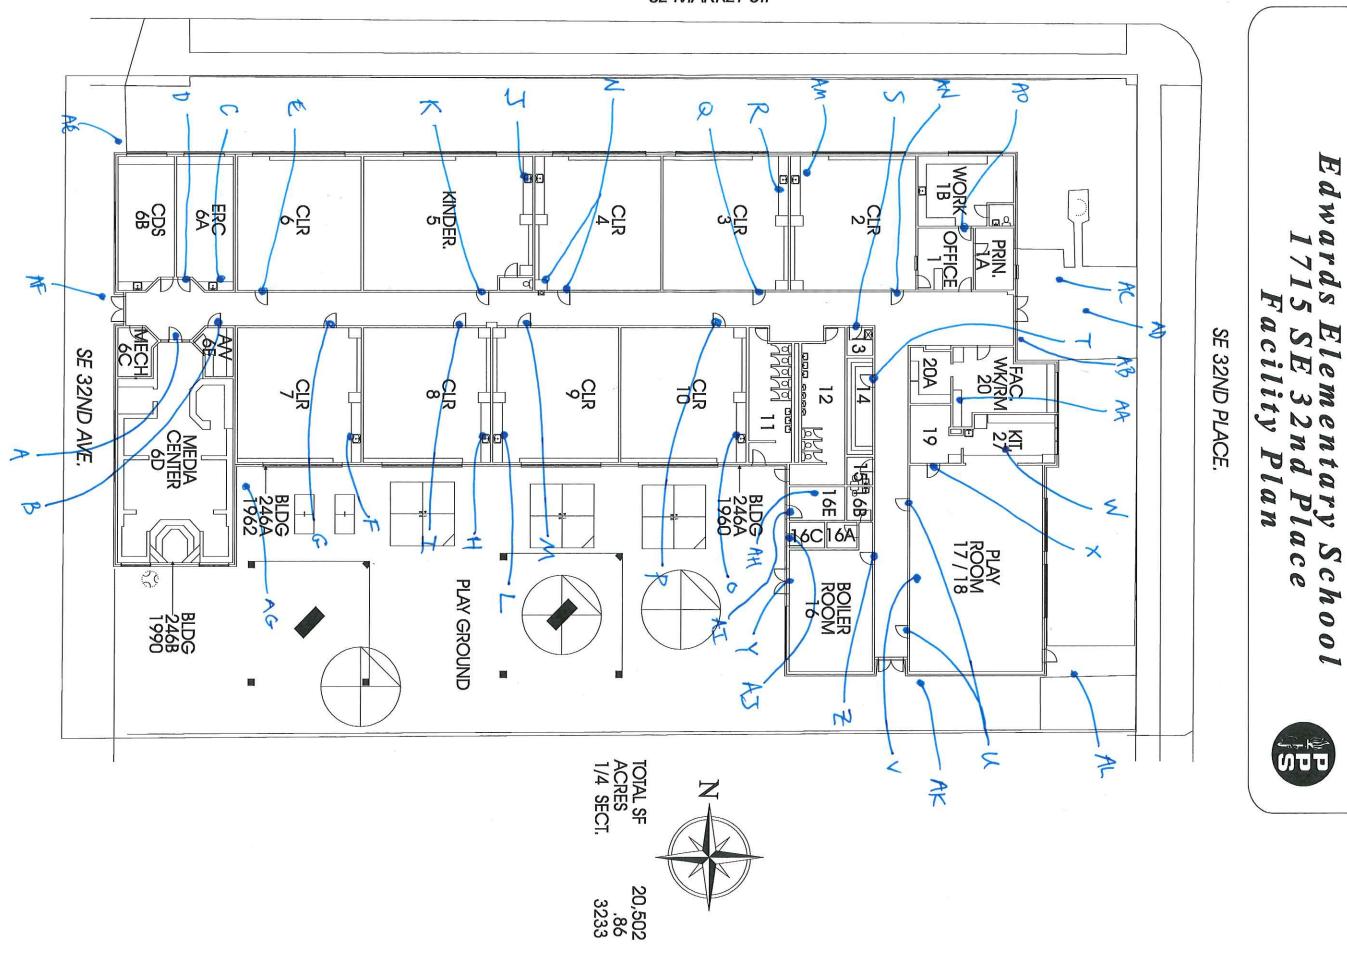

PUBLIC HEALTH DIVISION Center for Health Protection

Kate Brown, Governor



June 9, 2016

Clark R. Nelson PBS Engineering and Environmental Inc. 4412 S.W. Corbett Ave Portland, OR 97239

800 NE Oregon Street, Suite 640 Portland, OR 97232 Phone: (971) 673-0440 Fax: (971) 673-0457 TTY Nonvoice: (971) 673-0372

RE: LEAD-BASED PAINT ACTIVITIES, INDIVIDUAL CERTIFICATION NO. 1806--Indv--R

This letter is your official notification that you have met the certification requirements under Oregon Administrative Rule (OAR) 333-069 to conduct lead-based paint activities in Oregon, in the following Risk Assessor; Inspector disciplines:

In addition to certification by the Oregon Health Authority, you are required to be licensed by the Construction Contractors Board (CCB) if you plan to conduct lead-based paint activities in Oregon. This license is different than, and in addition to, the standard contractor license issued by CCB. Both individuals and firms must obtain this license. For more information on CCB lead-based paint licensing, visit their web site at www.oregon.gov/CCB or call 503-378-4621.

As a certified individual in Oregon, you must meet all the requirements of OAR 333-069, including work practice standards for conducting lead-based paint activities in target housing and child-occupied facilities. As a certified individual, you must perform work under a firm that is certified by the Authority for conducting leadbased paint activities.

You are required to wear the enclosed badge in plain view when conducting lead-based paint activities. Please note that the badge and certificate will expire on 6/30/2017. If you wish to maintain your certification after 6/30/2017, you must submit an application postmarked at least 60 days before expiration and document that your lead-based paint activities training is current.

As a public service the Authority publishes a list of individuals performing lead-base Oregon. The list is distributed statewide to consumers interested in lead-based paint s individuals that are certified by the state are eligible to be on this list.

If you have any questions concerning your certification or other aspects of the Lead-I please contact program staff at 971-673-0440.

Sincerely,

Ben Maynard Lead-Based Paint Program Oregon Health Authority

Enclosures: 1) Badge; 2) Certificate



C

E

R

T

F

E

D

Risk Assessor Inspector Lead-Based Paint Activities CERTIFICATION # 1806---Indv---R 6/30/2017 Expires

Clark R. Nelson

State of Oregon Oregon Health Authority

Clark R. Nelson

is certified by the Oregon Health Authority to conduct Lead-Based Paint Activities

Risk Assessor

Certification Number: Issuance Date: Expiration Date:

1806--Indv--R 6/9/2016 6/30/2017





CLARK RICHARD NELSON 4412 SW CORBETT AVE PORTLAND, OR 97239

9151806-RA

CONSTRUCTION CONTRACTORS BOARD LEAD BASED PAINT RISK ASSESSOR LICENSE

EXPIRATION DATE: 6/24/2017 This document certifies that

CLARK RICHARD NELSON 4412 SW CORBETT AVE PORTLAND, OR 97239 is licensed in accordance with Oregon Law as a Lead Based Paint Risk Assessor.

STATE OF OREGON

CONSTRUCTION CONTRACTORS BOARD LEAD BASED PAINT RISK ASSESSOR LICENSE

LICENSE NUMBER: 9151806-RA

This document certifies that:

CLARK RICHARD NELSON 4412 SW CORBETT AVE PORTLAND, OR 97239

is licensed in accordance with Oregon Law as a Lead Based Paint Risk Assessor.

License Details:

LICENSE NO.: 9151806-RA EXPIRATION DATE: 6/24/2017 Kate Brown, Governor

May 17, 2016

PBS Engineering and Environmental Inc. 4412 SW Corbett Ave Portland, OR 97239 800 NE Oregon Street, Suite 640 Portland, OR 97232 Phone: (971) 673-0440 Fax: (971) 673-0457 TTY Nonvoice: (971) 673-0372

Attention: Derek May

RE: LEAD-BASED PAINT ACTIVITIES, FIRM CERTIFICATION NO. 1038--LBP FIRM

This letter is your official notification that PBS Engineering and Environmental Inc. has met certification requirements under Oregon Administrative Rules (OAR) 333-069 to conduct lead-based paint activities in Oregon. Please note that the enclosed certificate will expire on 6/30/2017.

In addition to certification by the Oregon Health Authority (Authority), PBS Engineering and Environmental Inc. is required to be licensed by the Construction Contractors Board (CCB) prior to conducting lead-based paint activities in Oregon. This license is different than, and in addition to, the standard contractor license issued by CCB. Both individuals and firms must obtain this license. For more information on CCB lead paint licensing, visit their web site at www.oregon.gov/CCB or call 503-378-4621.

As a firm certified to conduct lead-based paint inspection activities in Oregon, PBS Engineering and Environmental Inc. must meet all requirements set forth in OAR 333-069. It must comply with standards for conducting lead-based paint inspection and/or risk assessment activities in target housing and child-occupied facilities and employ only certified individuals to conduct regulated activities.

As a public service, the Authority publishes a list of firms performing lead-based paint activities in Oregon. The list is distributed statewide to consumers interested in lead-based paint services. Only those firms that are certified by the state are eligible to be on this list.

If you have any questions concerning this certification or other aspects of the Lead-Based Paint Program, please contact program staff at (971) 673-0440.

Sincerely,

Bu Mant

Ben Maynard Lead-Based Paint Program Oregon Health Authority

This document can be obtained in an alternate format by calling: (971) 673-0440.

State of Oregon Oregon Health Authority

PBS Engineering and Environmental Inc.


is certified by the Oregon Health Authority to conduct Lead-Based Paint Activities

Certification Number: Issuance Date: Date of Expiration: 1038--LBP FIRM 5/16/2016 6/30/2017





PBS ENGINEERING & ENVIRONMENTAL INC 4412 SW CORBETT PORTLAND OR 97239

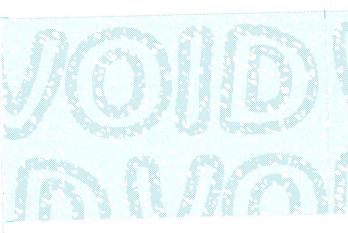

CONSTRUCTION CONTRACTORS BOARD LEAD INSPECTION CONTRACTORS LICENSE LICENSE No.: LBPI129143 EXPIRATION DATE: 7/31/2017

This document certifies that

PBS ENGINEERING & ENVIRONMENTAL INC 4412 SW CORBETT PORTLAND OR 97239 is licensed in accordance with Oregon Law as

a Lead Inspection Contractor.

STATE OF OREGON CONSTRUCTION CONTRACTORS BOARD LEAD INSPECTION CONTRACTORS LICENSE

LICENSE NUMBER: LBPI129143

This document certifies that: PBS ENGINEERING & ENVIRONMENTAL INC 4412 SW CORBETT PORTLAND OR 97239

is licensed in accordance with Oregon Law as a Lead Inspection Contractor.

License Details: LBPI LICENSE NO.: LBPI129143 EXPIRATION DATE: 7/31/2017