

March 1, 2017

Courtney Wilton
Portland Public Schools
501 North Dixon
Portland, OR 97227

Via email: cwilton@pps.net

Regarding: Lead Paint Condition Assessment

Rieke Elementary School 1405 SW Vermont Street Portland, Oregon 97219

PBS Project: 6500.721 Phase 0042

Dear Mr. Wilton:

On February 9, 2017, PBS Engineering and Environmental Inc. (PBS) conducted a visual inspection and assessment of painted and varnished surfaces on the interior and exterior of Rieke Elementary School located at 1405 SW Vermont Street in Portland, Oregon.

PBS assessed painted and varnished interior and exterior hard surfaces as well as concrete, asphalt, soil, garden spaces, playground equipment, and windowsills adjacent or in close proximity to deteriorated painted or varnished surfaces.

Paint and varnish conditions were assessed using US Department of Housing and Urban Development (HUD) guidelines for the Evaluation and Control of Lead Based Paint Hazards in Housing (2012 Addition) Chapter 5: Risk Assessment and Reevaluation.

It is assumed that all paint and varnish at the school contain some concentration of lead. The purpose of this investigation is to identify those finishes in deteriorated condition.

FINDINGS

Overall, the building's painted and varnished surfaces were found to be in intact condition with areas of fair and deteriorated conditions. A table listing the locations and quantity of surfaces in deteriorated condition is attached to this report.

No paint chips were observed in the school's garden, but paint chips were observed on grass on the south side of the main building.

The school has metal push-out windows, and nothing of concern was noted in window troughs observed.

Painted playground and parking lot striping and curbing often contain lead and are generally in deteriorated condition due to weatherization and traffic. PBS did not assess this paint, but recommends restriping, as needed, to maintain in intact condition.

Lead Paint Condition Assessment Portland Public Schools, Rieke Elementary School March 1, 2017 Page 2 of 2

RECOMMENDATIONS

PBS recommends that all painted or varnished surfaces in deteriorated condition noted on the attached table be stabilized. All paint chips noted in this report should be removed.

Please feel free to contact me at 503.417.7691 or clark@pbsenv.com with any questions or comments.

Sincerely,

PBS Engineering and Environmental Inc.

Clark Nelson, CIH Senior Project Manager

Attachments: Condition Assessment of Deteriorated Paint/Varnish Table

Field Drawing of Deteriorated Paint and Varnish Locations Lead-based Paint Risk Assessor Certification (Clark Nelson)

Lead-based Paint Activities Firm Certification (PBS Engineering and Environmental)


CN:DM:bmp

Rieke Elementary School Assessment of Paint/Varnish in Deteriorated Condition

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
Α	Interior	Classroom 12	Built-in cabinets at sink	Above and below	Yes	Wood	50
В	Interior	Classroom 1	Built-in cabinets at sink	Above and below	Yes	Wood	50
С	Interior	Classroom 1	Doorframe	Above and below	Yes	Metal	15
D	Interior	Classroom 11	Doorframe	Above and below	Yes	Metal	15
E	Interior	Classroom 11	Built-in cabinets under sink	Below	Yes	Wood	30
F	Interior	Classroom 2	Doorframe	Above and below	Yes	Metal	15
G	Interior	Classroom 2	Built-in cabinets under sink	Below	Yes	Wood	30
Н	Interior	Classroom 10	Doorframe	Above and below	Yes	Metal	15
1	Interior	Classroom 10	Built-in cabinets under sink	Below	Yes	Wood	30
J	Interior	Classroom 3	Doorframe	Above and below	Yes	Metal	15
K	Interior	Classroom 3	Built-in cabinets under sink	Below	Yes	Wood	30
L	Interior	Boy's restroom	Doorframe	Above and below	No	Wood	60
М	Interior	Custodial next to boy's room	Doorframe	Above and below	No	Metal	15
N	Interior	Classroom 4	Doorframe	Above and below	Yes	Metal	15
0	Interior	Classroom 4	Built-in cabinets under sink	Below	Yes	Wood	30
Р	Interior	Classroom 5	Doorframe	Above and below	Yes	Metal	15
Q	Interior	Classroom 5	Built-in cabinets under sink	Below	Yes	Wood	30
R	Interior	Classroom 8	Doorframe	Above and below	Yes	Metal	15
S	Interior	Classroom 8	Built-in cabinets under sink	Below	Yes	Wood	20
Т	Interior	Classroom 6	Doorframe	Above and below	Yes	Wood and metal	30
U	Interior	Classroom 6	Built-in cabinets around sink	Above and below	Yes	Wood	50
V	Interior	Classroom 7	Built-in cabinets under sink	Below	Yes	Wood	30

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
W	Exterior	Outside portables, classroom 18	Deck	Below	No	Wood	200
X	Interior	Classroom 14	Door	Above and below	No	Wood	45
Υ	Interior	Classroom 14	Built-in cabinets under sink	Below	No	Wood	30
Z	Interior	Classroom 14	Windowsill	Below	No	Metal	4
AA	Interior	Classroom 15	Door and frame	Above and below	No	Wood and metal	60
AB	Interior	Classroom 15	Built-in cabinets under sink	Below	No	Wood	30
AC	Interior	Office workroom	Built-in cabinets under sink	Below	No	Wood	30
AD	Interior	Boiler room	Double doors and frame to exterior	Above and below	No	Metal	120
AE	Interior	Boiler room	Built-in closets in corner	Above and below	No	Wood	80
AF	Interior	Boiler room	Double doors to storage	Above and below	No	Wood	90
AG	Interior	Boiler room	Doo and frame to custodial office	Above and below	No	Wood and metal	60
AH	Exterior	Northeast corner of main building	Edge of roof overhang	Above	No	Metal	20
Al	Exterior	East exterior of main building	Edge of roof overhang	Above	No	Metal	20
AJ	Exterior	Southeast corner of main building	Metal posts	Below	No	Metal	18
AK	Exterior	Northeast corner of main building	Flag pole	Above and below	No	Metal	100
AL	Exterior	Outside boiler room doors	Paint chips on ground	Below	No	N/A	30
AM	Exterior	Breezeway to gym	Support columns	Above and below	No	Metal	60
AN	Exterior	Middle north building entrance	Handrails	Below	No	Metal	150
АО	Exterior	Covered play area	Support columns	Above and below	No	Wood	500
AP	Exterior	North exterior of classroom 15	Water fountain	Below	No	Metal	15
AQ	Exterior	Northeast corner of gym	Handrails	Below	No	Metal	150
AR	Exterior	Southside of covered play area	Trim along top	Above	No	Metal	50
AS	Exterior	Southwest corner of breezeway to gym	Edge of roof overhang	Above	No	Metal	5

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
AT	Interior	Kitchen	Doorframe to dry storage	Above and below	No	Metal	15
AU	Interior	Southeast corner of gym	Handrails	Below	No	Metal	20

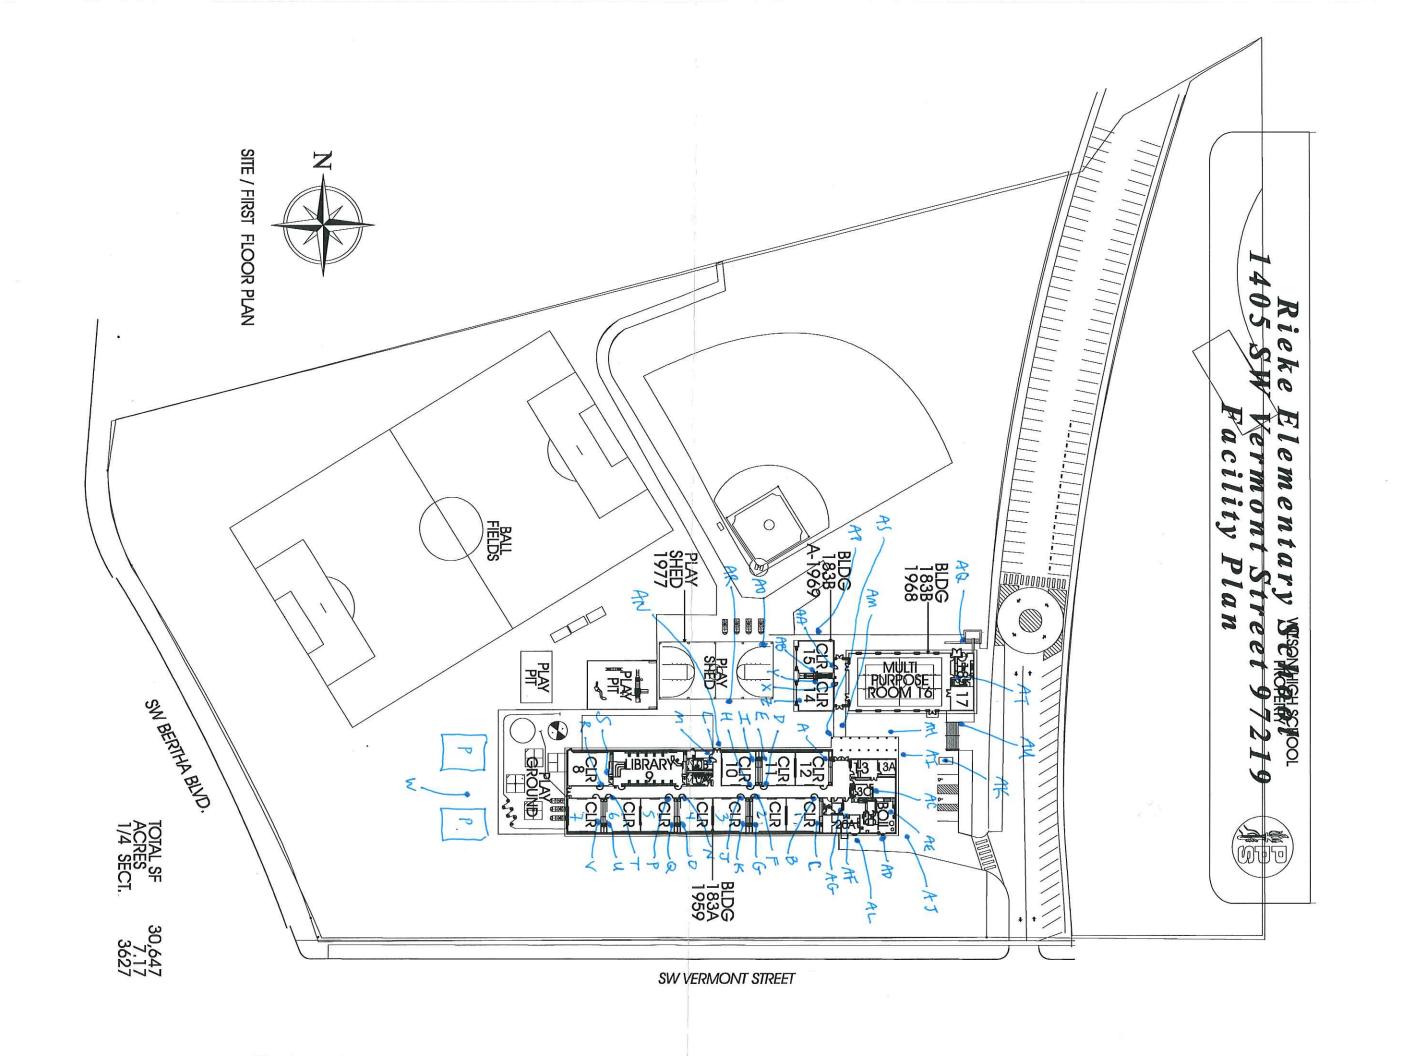

PUBLIC HEALTH DIVISION Center for Health Protection

Kate Brown, Governor



June 9, 2016

Clark R. Nelson PBS Engineering and Environmental Inc. 4412 S.W. Corbett Ave Portland, OR 97239 800 NE Oregon Street, Suite 640

Portland, OR 97232 Phone: (971) 673-0440

Fax: (971) 673-0457

TTY Nonvoice: (971) 673-0372

RE: LEAD-BASED PAINT ACTIVITIES, INDIVIDUAL CERTIFICATION NO. 1806--Indv--R

This letter is your official notification that you have met the certification requirements under Oregon Administrative Rule (OAR) 333-069 to conduct lead-based paint activities in Oregon, in the following disciplines: Risk Assessor; Inspector

In addition to certification by the Oregon Health Authority, you are required to be licensed by the Construction Contractors Board (CCB) if you plan to conduct lead-based paint activities in Oregon. This license is different than, and in addition to, the standard contractor license issued by CCB. Both individuals and firms must obtain this license. For more information on CCB lead-based paint licensing, visit their web site at www.oregon.gov/CCB or call 503-378-4621.

As a certified individual in Oregon, you must meet all the requirements of OAR 333-069, including work practice standards for conducting lead-based paint activities in target housing and child-occupied facilities. As a certified individual, you must perform work under a firm that is certified by the Authority for conducting lead-based paint activities.

You are required to wear the enclosed badge in plain view when conducting lead-based paint activities. Please note that the badge and certificate will expire on 6/30/2017. If you wish to maintain your certification after 6/30/2017, you must submit an application postmarked at least 60 days before expiration and document that your lead-based paint activities training is current.

As a public service the Authority publishes a list of individuals performing lead-base Oregon. The list is distributed statewide to consumers interested in lead-based paint s individuals that are certified by the state are eligible to be on this list.

If you have any questions concerning your certification or other aspects of the Lead-I please contact program staff at 971-673-0440.

Sincerely,

Ben Maynard

Lead-Based Paint Program Oregon Health Authority

Enclosures: 1) Badge; 2) Certificate

Clark R. Nelson

Risk Assessor Inspector Lead-Based Paint Activities

CERTIFICATION # 1806--Indv--R 6/30/2017

Expires

ERTIFIED

State of Oregon Oregon Health Authority

Clark R. Nelson

is certified by the Oregon Health Authority to conduct Lead-Based Paint Activities

Risk Assessor

Certification Number:

1806--Indv--R

Issuance Date:

6/9/2016

Expiration Date:

6/30/2017





CLARK RICHARD NELSON 4412 SW CORBETT AVE PORTLAND, OR 97239

CONSTRUCTION CONTRACTORS BOARD LEAD BASED PAINT RISK ASSESSOR LICENSE

EXPIRATION DATE: 6/24/2017

This document certifies that

CLARK RICHARD NELSON 4412 SW CORBETT AVE PORTLAND, OR 97239

is licensed in accordance with Oregon Law as a Lead Based Paint Risk Assessor.

9151806-RA

STATE OF OREGON CONSTRUCTION CONTRACTORS BOARD LEAD BASED PAINT

RISK ASSESSOR LICENSE

LICENSE NUMBER: 9151806-RA

This document certifies that:

CLARK RICHARD NELSON 4412 SW CORBETT AVE PORTLAND, OR 97239

is licensed in accordance with Oregon Law as a Lead Based Paint Risk Assessor.

License Details:

LICENSE NO.: 9151806-RA EXPIRATION DATE: 6/24/2017

PUBLIC HEALTH DIVISION Center for Health Protection

Kate Brown, Governor



May 17, 2016

PBS Engineering and Environmental Inc. 4412 SW Corbett Ave Portland, OR 97239

Attention: Derek May

800 NE Oregon Street, Suite 640 Portland, OR 97232

Phone: (971) 673-0440

Fax: (971) 673-0457 TTY Nonvoice: (971) 673-0372

RE: LEAD-BASED PAINT ACTIVITIES, FIRM CERTIFICATION NO. 1038--LBP FIRM

This letter is your official notification that PBS Engineering and Environmental Inc. has met certification requirements under Oregon Administrative Rules (OAR) 333-069 to conduct lead-based paint activities in Oregon. Please note that the enclosed certificate will expire on 6/30/2017.

In addition to certification by the Oregon Health Authority (Authority), PBS Engineering and Environmental Inc. is required to be licensed by the Construction Contractors Board (CCB) prior to conducting lead-based paint activities in Oregon. This license is different than, and in addition to, the standard contractor license issued by CCB. Both individuals and firms must obtain this license. For more information on CCB lead paint licensing, visit their web site at www.oregon.gov/CCB or call 503-378-4621.

As a firm certified to conduct lead-based paint inspection activities in Oregon, PBS Engineering and Environmental Inc. must meet all requirements set forth in OAR 333-069. It must comply with standards for conducting lead-based paint inspection and/or risk assessment activities in target housing and child-occupied facilities and employ only certified individuals to conduct regulated activities.

As a public service, the Authority publishes a list of firms performing lead-based paint activities in Oregon. The list is distributed statewide to consumers interested in lead-based paint services. Only those firms that are certified by the state are eligible to be on this list.

If you have any questions concerning this certification or other aspects of the Lead-Based Paint Program, please contact program staff at (971) 673-0440.

Sincerely,

Ben Maynard

Bu Mand

Lead-Based Paint Program

Oregon Health Authority

This document can be obtained in an alternate format by calling: (971) 673-0440.

State of Oregon Oregon Health Authority

PBS Engineering and Environmental Inc.

is certified by the Oregon Health Authority to conduct Lead-Based Paint Activities

Certification Number:

1038--LBP FIRM

Issuance Date:

5/16/2016

Date of Expiration:

6/30/2017





PBS ENGINEERING & ENVIRONMENTAL INC 4412 SW CORBETT PORTLAND OR 97239

> CONSTRUCTION CONTRACTORS BOARD LEAD INSPECTION CONTRACTORS LICENSE LICENSE No.: LBPI129143 EXPIRATION DATE: 7/31/2017

This document certifies that

PBS ENGINEERING & ENVIRONMENTAL INC 4412 SW CORBETT PORTLAND OR 97239

is licensed in accordance with Oregon Law as a Lead Inspection Contractor.

STATE OF OREGON CONSTRUCTION CONTRACTORS BOARD LEAD INSPECTION CONTRACTORS LICENSE

LICENSE NUMBER: LBPI129143

This document certifies that:

PBS ENGINEERING & ENVIRONMENTAL INC 4412 SW CORBETT PORTLAND OR 97239

is licensed in accordance with Oregon Law as a Lead Inspection Contractor.

License Details:

LBPI LICENSE NO.: LBPI129143 EXPIRATION DATE: 7/31/2017